



## Low-velocity impact behaviour of woven laminate plates with fire retardant resin

Marzio Grasso<sup>a,\*</sup>, Yigeng Xu<sup>b</sup>, Amit Ramji<sup>b</sup>, Gang Zhou<sup>c</sup>, Andreas Chrysanthou<sup>d</sup>, George Haritos<sup>a</sup>, Yong Chen<sup>d</sup>

<sup>a</sup> Kingston University, School of Engineering and the Environment, United Kingdom

<sup>b</sup> Cranfield University, School of Aerospace, Transport and Manufacturing, United Kingdom

<sup>c</sup> Loughborough University, Aeronautical and Automotive Engineering, United Kingdom

<sup>d</sup> University of Hertfordshire, School of Engineering and Computer Science, United Kingdom

### ARTICLE INFO

#### Keywords:

Low-velocity impact  
Woven composite  
Delamination  
Matrix crack  
Fibre breakage

### ABSTRACT

The understanding of the damage mechanisms for woven laminate plates under low-velocity impact is challenging as the damage mechanisms at the interface of adjacent layers are dominated by the fibre architecture. This work presents an experimental investigation of the behaviour of woven glass and carbon fibre composite laminates in a matrix of fire retardant resin under low-velocity impact. The performance is evaluated in terms of damage mechanisms and force time history curves. Six impact energy levels were used to test standard plates to identify the type of damage observed at various energy levels. Scanning electron microscopy (SEM) along with C-scans were used to characterise the damage. It has been observed that in woven composites, the damage occurs mostly between the fibre bundles and matrix. As the impact energy increases, the failure involves extended matrix cracking and fibre fracture. Moreover, due to the fibre architecture, both the contact forces between bundles of fibres and stretching of the bundles are responsible for the dominant matrix cracking damage mode observed at the low-impact energy level. As the impact energy increases, the damage also increases resulting in fibre fracture. The experimental evidence collected during this investigation shows that for both the carbon fibre and the glass fibre woven laminates the low-velocity impact behaviour is characterised by extended fibre fracture without a noticeable sudden load drop.

### 1. Introduction

Composite laminates are often subjected to low-velocity impact while in service and during manufacture [1,2]. Unlike their damage-tolerant metallic counterparts, which can absorb impact energy via plastic deformation, composite laminates tend to suffer internal damage due to the inherent brittle nature of the fibres and the matrix. This can lead to further propagation during loading in service. Barely-visible impact damage (BVID) can be introduced at any point of the laminate [3], sometimes far away from the impact site. At low-velocity and low-energy impact [4], typical damage mechanisms include indentation, matrix cracking, delamination, fibre fracture and back-face fibre splitting [5,6]. The first stage of damage is usually matrix cracking, but this does not significantly alter the laminate stiffness [7]. However, the crack tips can act as initiation sites for delamination and fibre breakage during further loading scenarios. The residual strength of

the composite panel after impact is also related to the extent of delamination. Attempts to map the impacted region and identify the type and extent of damage have been reported in the literature [8]. Under low-velocity and low-energy impact, four main damage regions, each of them characterised by a different type of damage, were reported [9]. The central region suffered mainly matrix cracking whilst the external areas were mainly affected by interface debonding and delamination [9].

Great attention has been devoted to the assessment of the effects of various parameters on low-velocity impact damage. These parameters include; thickness [10,11], fibre orientation, fibre crimp [12,13], type of resin and type of fibre [14]. Several authors [1,4,15,16] studied the effect of the ply thickness on the damage resistance and damage tolerance by analysing the results of impact tests and the compressive residual strength. In most cases it has been observed that thicker plies predominantly lead to delamination, while thinner plies experience

\* Corresponding author.

E-mail address: [m.grasso@kingston.ac.uk](mailto:m.grasso@kingston.ac.uk) (M. Grasso).

<https://doi.org/10.1016/j.compositesb.2019.04.023>

Received 11 February 2019; Received in revised form 12 April 2019; Accepted 24 April 2019

Available online 27 April 2019

1359-8368/Crown Copyright © 2019 Published by Elsevier Ltd. All rights reserved.

fibre breakage during impact [16,17]. Referring to the various stages of damage, when the impact energy is very low, no damage is usually detected [18]. By increasing the impact energy, delamination is initially observed followed by fibre damage at higher energy levels. It has also been observed that the stiffness of the plates is mostly affected by delamination [10]. For thin plates, the membrane effects become significant before fibre fracture takes place, resulting mostly in delamination rather than matrix cracks. For high energy impact, fibre damage is observed in the form of a “saw-tooth” pattern in the force history response [19]. Samples of greater thickness exhibit different behaviour with extended fibre fracture at high energy impact and a local decrease in stiffness in correspondence with the impact area, resulting in perforation of the plate.

The interactions among the above mechanisms rely on several parameters such as materials variables, loading conditions, fibre configurations and stacking sequence. The improvement of the impact damage resistance has been a challenge in composite materials and most techniques developed are based on two main approaches; one involves the fibre architecture and the other the improvement of the material properties of the constituents. The fibre architecture approach is related to the way the fibres are arranged to produce 2D and 3D structures. The material property approach leads to the improvement of the fracture toughness of the matrix as well as the bonding between fibres and matrix. For that reason several studies have been carried out in order to improve the bonding between fibres and matrix by treating the fibre surface as well as developing tougher resins.

In the present study, the damage mechanisms induced by low-velocity impact are investigated through the analysis of damaged cross-sections at different impact energy levels for two materials, namely glass and carbon fibres composites. The damage morphology of the cross-sections under various impact energy levels allows the observation of the different mechanisms involved in the impact damage and energy based damage evolution. The main features characterising the damage morphology of the glass and carbon woven materials are highlighted.

## 2. Materials and methods

### 2.1. Materials and specimen compositions

The experimental results have been collected by testing glass and carbon composite plates under low-velocity impact. 36 specimens for each type of fibre were manufactured by layup of prepreg materials followed by curing in an autoclave. The carbon composite plates are composed of 11 laminae arranged in a layup sequence of  $[(0/90)_5\overline{90}]_s$ . The carbon fibre composite was made of E720/T300, which is a multiple prepreg manufactured by TenCate. TenCate E720 is a toughened epoxy resin system for cures at 120 °C for 90 min, pre-impregnated into high-performance fibres such as carbon and glass. T300 is a woven carbon fibre ply, with a fabric density of 280 GSM, twilled in  $2 \times 2$  weave style. The glass composite plates were composed of 11 Texipreg EE300/EF452 laminae arranged in a layup sequence of  $[(0/90)_F]_{11}$ . EF452 is a fire retardant, self-adhesive prepreg system which contains no halogenated flame retardants. It is suitable for sandwich panels or solid laminates. EE300 is a plain weave glass fibre ply, with a fabric density of 300 GSM. The final range of thickness values for the carbon and glass composite plates is  $4.6 \pm 0.06$  mm and  $3.42 \pm 0.02$  mm respectively. The mechanical properties of the glass and carbon fibres are shown in Tables 1 and 2. Early research on woven composite laminates with flame retardant resins [20–22] has shown that the additives used to enhance the flame-retardancy of the resin lead to an improvement in the thermal properties and a reduction in the mechanical properties. Moreover, the additives have been observed to improve the impact resistance and the Interlaminar Shear Strength (ILSS). The higher ILSS is responsible for the enhanced low velocity impact performance compared to the

**Table 1**  
Mechanical Properties of Carbon fibre reinforced woven layer.

Property	Condition	Standard Method	Typical Value	Units
Tensile Strength	RTD	EN ISO 524-4	621	MPa
Tensile Modulus	RTD	EN ISO 524-4	58.4	GPa
Compression Strength	RTD	EN 2850	488	MPa
Compression Modulus	RTD	EN 2850	70	GPa
In-Plane Shear Strength	RTD	EN ISO 14129	99	MPa
In-Plane Shear Modulus	RTD	EN ISO 14129	3.5	GPa
Flexural Strength	RTD	EN ISO 14125	801	MPa
Flexural Modulus	RTD	EN ISO 14125	52.4	GPa
ILSS	RTD	EN ISO 14130	62.1	MPa

<https://www.tencatecomposites.com/product-explorer/products/aBwR/E720>.

**Table 2**  
Mechanical Properties of Glass fibre reinforced woven layer.

Cured Material Properties (I)	Condition	Standard Method	Typical Value	Unit
Cured Ply Thickness	RTD		0.22	mm
Tensile Strength	RTD	ASTM D 3039	450	MPa
Tensile Modulus	RTD	ASTM D 3039	24.5	GPa
Flexural Strength	RTD	ASTM D 790	480	MPa
Flexural Modulus	RTD	ASTM D 790	24	GPa
Compressive Strength	RTD	Modified ASTM D695 (SACMA SRM 1–88)	N/A	MPa
ILSS	RTD	ASTM D 2344	35	MPa

<http://www.saati.de/images/composites/prepregs/ef452.pdf>.

(1) The tests were carried out @ 23 °C and 60% R.H. on specimens cured in std conditions (dwell @150° for 1 h in hot plate press. External pressure applied: 3 bar). The tests were performed along the warp direction.

conventional woven composite laminates.

For each type of fibres, the plates were cut out from a single panel. Low-velocity impact tests were performed in accordance with ASTM D7136/D7136M Standard [23] using an Imatek drop-weight tower shown in Fig. 1. The total mass of the striker was 2.464 kg and the impactor diameter was 25 mm. Prior to the impact tests, a C-Scan was performed for all samples in order to assess the initial damage status. The damage produced after impact was assessed by using the same non-destructive method.

The impact energy is controlled by the drop height to provide the nominal impact energy values of 5J, 7.5J, 10J, 15J, 20J, and 30J. The specimens were clamped on a rectangular plate as shown in Fig. 1 b. Time histories of the impact force, velocity, acceleration, and displacement were obtained. The load cell used was a calibrated Kistler 9331B in-line load cell connected by a gold plated coaxial cable attached to a Kistler analyser and Imatek C3008 signal amplifier.

Ultrasound scanning techniques using a Sonatest Veo 16:64 with a linear 64 element probe in a water tank were used for the detailed identification of the post-impact damage area. Finally, some of the specimens were cut carefully into two halves along a central line to reveal the damage inside and was examined by Scanning Electron Microscopy (SEM) using a JEOL JEM-1400 Plus.

## 3. Results and discussion

### 3.1. Dynamic response of woven composite plates under low velocity impact

Fig. 2 shows the impact force-time histories of the woven composite laminate plates under the low-velocity impact at six energy levels.

The general trend of the dynamic response is similar for the two woven plates made of different reinforcement fibres. The impact duration is independent of the impact energy level. The profile of the impact force history is symmetrical [24] about the peak impact force and can be

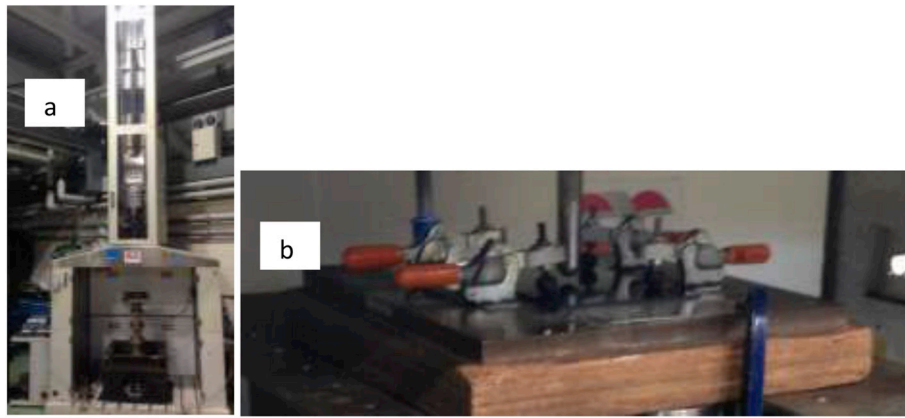


Fig. 1. Drop-weight tower used for the low velocity impact testing: a) the drop weight machine, b) the holding mechanism for the sample in the drop tower.

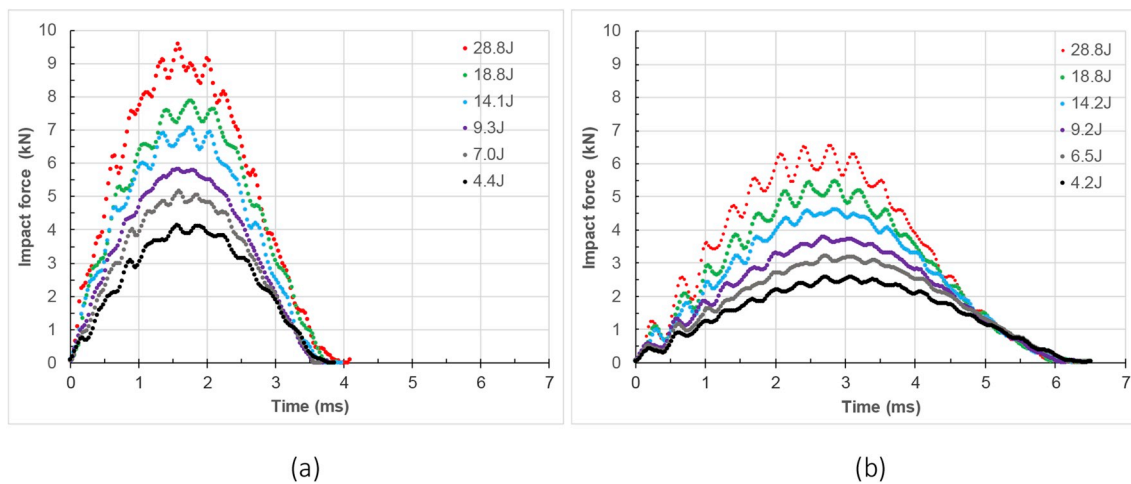


Fig. 2. Impact force – time curves of (a) woven carbon fibre and (b) woven glass fibre composite laminates.

described by a sine function. This is in contrast to that observed with unidirectional composite laminates where the force-time curve is shifted towards the loading phase when impact damage is introduced [15]. The fluctuations of the impact force about the sine wave profile are primarily due to elastic wave responses and vibration of the specimen and are repeatable for replicate tests [15]. At low-impact energy, indentation as illustrated in Fig. 3 is the main damage mechanism and the level of the force fluctuation on the loading phase is similar to that on the unloading phase. At high-impact energy when other damage mechanisms are activated, the force fluctuation on the loading phase increases while the unloading phase is much smoother.

The woven carbon fibre laminate plate exhibits an overall 40% shorter impact duration and a peak value of the maximum force that exceeds the value for the woven glass fibre laminate plates under similar impact energy levels by at least 47%. This different behaviour is related to the lower stiffness of the glass fibre composite compared to the carbon

fibre composite. The lower stiffness is also responsible for the higher deflection of the glass fibre composite plate (37% on average) under the maximum force compared to the carbon fibre composite plate. The maximum vertical displacement measured during the low velocity impact tests has been compared with the maximum deflection predicted with the plate theory using only the first four terms of the series. In particular, using the Navier solution [25] for the case of a simply-supported square plate with a single load concentrated at the central point, the maximum deflection can be expressed as

$$w_{max} = \frac{0.01121Pa^2}{D} \tag{1}$$

where P is the single load applied in the middle of the plate, a is the side length of the plate and D is the flexural rigidity of the plate defined as

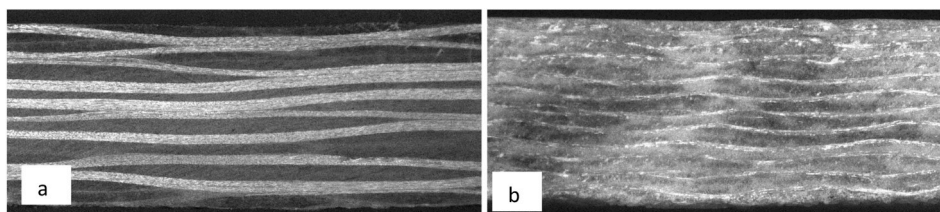


Fig. 3. Cross-sections showing the indentation of a) carbon fibre sample tested at 10 J and b) glass fibre sample tested at 5 J.

$$D = \frac{Eh^3}{12(1 - \nu^2)} \quad (2)$$

where E is the equivalent elastic modulus,  $\nu$  is the Poisson's ratio and h is the thickness of the plate. Using Eq. (1) and the maximum load values reported in Tables 3 and 4, the maximum deflection was derived and compared with the experimental values. Fig. 4 shows good agreement of the maximum deflection values between the experimental results and the theoretical predictions using Eq. (1).

The force-time history curves in Fig. 2 show no noticeable sudden load drop for the woven plates with both fibre types. This observation is different from that for unidirectional composite laminates where a sudden load drop is commonly used to identify the delamination threshold load due to specimen stiffness loss as a result of laminate level damage. The results of the present study are consistent with the observation of Giannopoulos et al. [26] who were not able to identify a delamination threshold load from the filtered impact force time history curve of a woven composite plate. The low-velocity impact tests performed on woven composites by Kim and Sham [9] also showed no load drop nor slope changes until the load reached a maximum.

Fig. 5 shows the impact force-displacement histories of the woven composite laminate plates under low-velocity impact of the six energy levels. The load drop or change of slope of the load-displacement curve may indicate nominal stiffness reduction due to the introduction of damage [8,27,28]. It is however, worth noting that for both the woven carbon fibre laminate plate and the glass fibre laminate, there is no noticeable load drop of the loading phase even at the highest impact energy of 28.8J. However, the load displacement curves for the carbon composite show a change in the slope around 6500 N (Fig. 5a). As discussed in the next paragraph, SEM analysis of samples tested at higher energy, the change in slope could be linked to fibre fracture and delamination. Similar behaviour was reported by Giannopoulos et al. [26] for CFRP material with fire retardant properties was tested under low velocity impact. The force-time history curves did not show any load drop. However, a change in the slope of the force displacement curves was observed around 4.2 kN with nominal thickness of cured laminates of 6.5 mm. Using the same approach the load drop for the material tested in this work is around 6.5 kN for the carbon fibre composite. The values for the glass fibre composite cannot be identified since there is no change in the slope of the force displacement curve (Fig. 5b).

There is no hysteresis in the loading and unloading phases for the woven carbon fibre plate under 4.4J impact and the woven glass fibre plate under 4.2J impact, indicating there is no noticeable energy absorption through damage during the impact event. As the impact energy level increased, the unloading curve became well-separated from the loading curve indicating that the specimen absorbed a significant fraction of the impact energy through local indentation and other damage mechanisms. The slope of the loading phase under high-impact energy levels, however, remains the same as the one under low-impact energy levels.

### 3.2. Energy absorbed through damage mechanisms

Fig. 6 shows the C-scan images of the damage areas of the woven

**Table 3**

Experimental results obtained for the Carbon Fibre Composite tested at Low Velocity Impact.

Impact Energy (J)	Absorbed Energy (J)	Peak Force (N)	Maximum Displacement (mm)	Impact Duration (ms)
4.49	0.557	4206	2.06	3.90
6.99	1.595	5077	2.55	3.66
9.27	2.179	5764	2.84	3.63
14.11	3.925	7051	3.53	3.69
18.83	6.489	8149	4.17	3.72
28.80	13.120	9516	5.41	3.81

**Table 4**

Experimental results obtained for the Glass Fibre Composite tested at Low Velocity Impact.

Impact Energy (J)	Absorbed Energy (J)	Peak Force (N)	Maximum Displacement (mm)	Impact Duration (ms)
4.24	0.202	2563	2.87	6.33
6.70	0.714	3158	4.16	6.18
9.20	1.912	3740	4.94	6.18
14.06	4.706	4776	5.77	6.09
19.09	7.389	5500	6.91	6.15
28.39	14.190	6469	8.39	6.24

plates under the six impact energy levels. The overall shape of the damage is elliptical. The impact damage is very small at low impact energy levels and may only be related to the local indentation. This is supported by the small hysteresis of the force-displacement curves shown in Fig. 5. The impact damage areas shown in Fig. 6a) are less than 10% of the delamination areas reported by Giannopoulos et al. [26] for the CFRP material with fire retardant resin for the same impact energy range. The difference could be related to the thickness, as the samples tested in Ref. [26] are 6.5 mm, and the fire retardant additives. The damage area shown in Fig. 6 increases with the impact energy. The damage area for the glass fibre laminate plate increases more quickly than that of the woven carbon fibre plate.

Fig. 7 shows the energy-time histories of the woven composite laminate plates under low-velocity impact of the six energy levels. The energy absorbed by the composite laminates is represented by the difference between the initial impact energy and the kinetic energy of the impactor. The resulting plateau in the energy-time curve represents the energy absorbed by the composite laminates, and is primarily dissipated through the creation of damage.

Fig. 8 presents the energy absorbed through damage shown in Fig. 7 as a percentage of the impact energy. The results are consistent with those shown in Fig. 7 and show that at lower impact energy, the carbon fibre woven plate absorbs more energy than the glass fibre woven plate. At high level of impact energy (>9J), the glass fibre woven plate absorbs more energy than the carbon fibre woven plate, indicating a possible change of the damage mechanism between the two woven plates as the impact energy increases.

The symmetrical nature of the force-time history, the lack of sudden load drop, and the slope change of the force-time and force-displacement curves are observed consistently for the tests on the two types of woven laminate plates under the six different impact energy levels. These observations are different to those commonly observed for unidirectional laminate plates under low-velocity impact, indicating different damage mechanisms in woven plates. Matrix cracking may play a much more important role in energy absorption for woven laminate plates compared with unidirectional laminate plates where delamination is the dominant damage mechanism. Detailed microscopic examination of the sectioned samples carried out for the assessment of the damage mechanisms in woven laminate plates is presented and discussed in the following section.

### 4. Damage morphology of sectioned samples

For the particular composite investigated in this work, it seems that the combination of strength of fibre-matrix bond and the inter-laminar fracture toughness ( $G_{IIc}$ ) are responsible for the feature of the force-time history curve in which a load drop is not evident. In order to describe the damage that occurred mainly in the three layers close to the bottom face as a result of impact at different energy levels, SEM examination was performed for cross-sections of the tested samples. For very low-impact energy on carbon fibre composite the first level at which damage is observed is 15J. For glass fibre composite the first damage is observed at 7J.

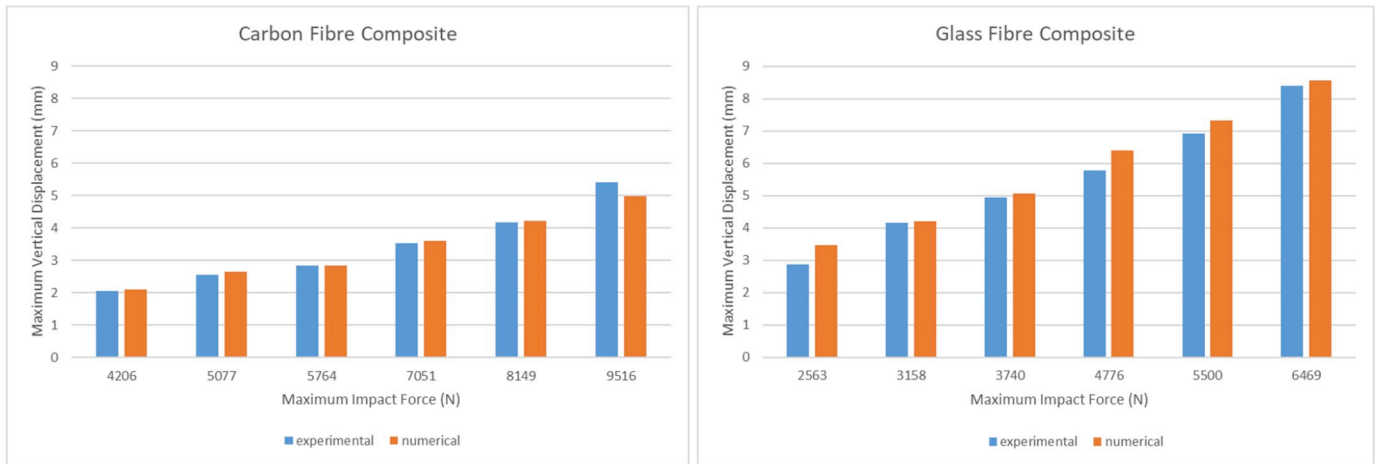


Fig. 4. Comparison of the experimental and theoretical maximum deflection of a) carbon fibre and b) glass fibre samples.

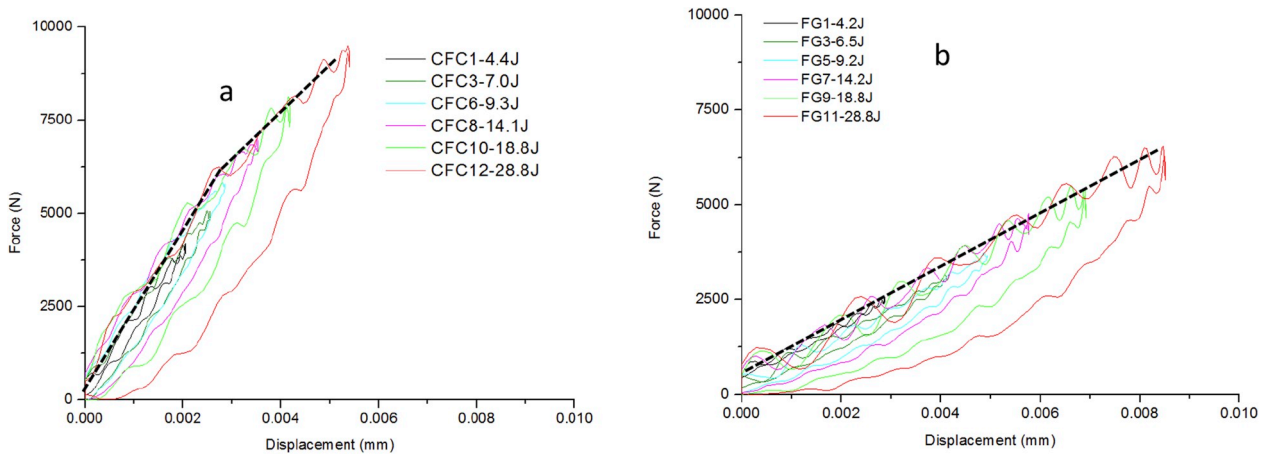


Fig. 5. Impact force – displacement curves for a) woven carbon fibre composite laminates and b) woven glass fibre composite laminates (the dotted lines show the change in stiffness observed for the carbon fibre composite).

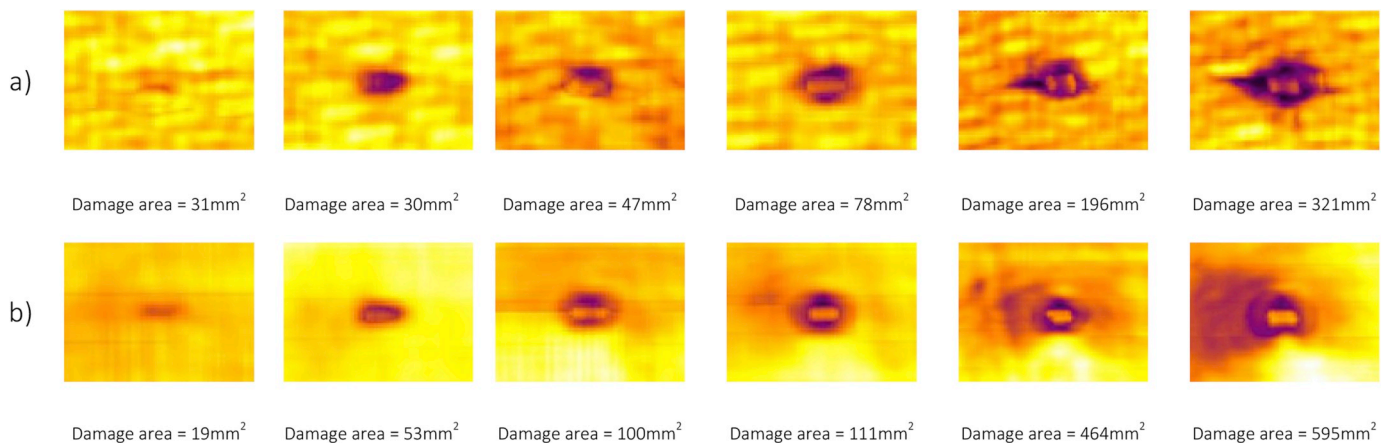


Fig. 6. C-scan images showing impact damage areas of a) the woven carbon fibre plates and b) the woven glass fibre plates under energy levels from low (left) to high (right).

4.1. Woven carbon fibre composites

In Fig. 9, cross-sections of the carbon composite samples tested at 15J, 20J and 30J are shown. Matrix cracking is the first damage mechanism to be observed (Fig. 9a) and is associated with the damage at

the interface between the fibres and the matrix from where the crack initiates. The matrix cracking observed at 15J is also observed at 20J (Fig. 9b) along with more extended damage at the interface and in-between the layers (Fig. 9c). However, at higher-impact energy there is a higher deflection and most of the damage is located at the back-side

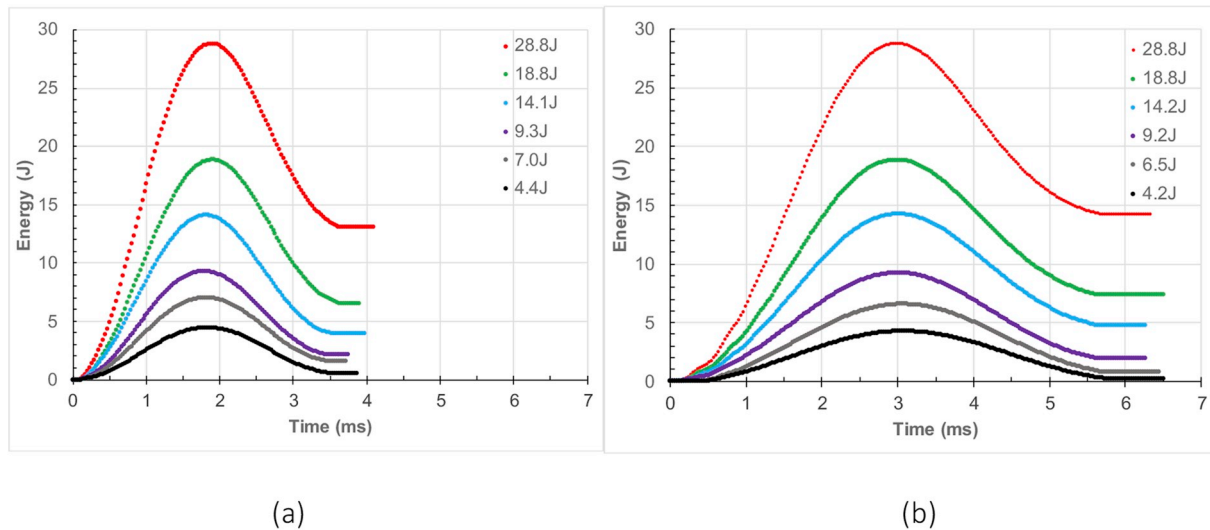


Fig. 7. Energy-time curves of: (a) woven carbon fibre and (b) woven glass fibre composite laminates.

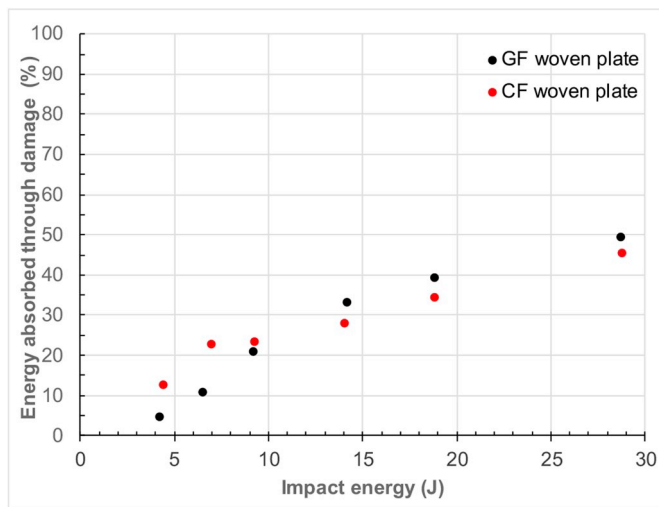


Fig. 8. Energy absorbed through damages as a percentage of the impact energy.

of the plates. The higher deflection causes the back-side to be subjected to higher membrane strain resulting in fibre fracture and damage between adjacent layers (Fig. 9d). The damage sequence observed in this work is consistent with that reported by Giannopoulos et al. [26]. At low impact energy the main damage is matrix cracking whilst at higher energy extended matrix cracking and fibre fracture is observed.

#### 4.2. Woven glass fibre composites

SEM performed on the glass fibre composites shows that the damage appears at a lower impact energy compared to the carbon fibre composites (Fig. 10a). In particular it is possible to identify three distinct levels in the sequence of the damage mechanisms. The first level only involves matrix cracking, the second level is a combination of matrix cracking and fibre fracture and the third level is characterised by extended damage on the back-side.

The damage initiated at the interface between the fibres and the matrix (Fig. 10a) and propagated within the matrix following the fibres (Fig. 10b) and the fibre bundles. The membrane stress acting in each layer stretched the fibre bundles pushing the bundles against each other, producing a closure effect. For this reason the cracks developed in the

matrix did not propagate between the bundles. At the higher-impact energy level the tension in the fibre bundles will act as a localised load on the bundle in contact (Fig. 11) due to the woven architecture and membrane stress associated with the higher deflection. Moreover, the higher deflection increased the strain in the fibres which act with the localised load, resulting in a higher contact force at the interface between fibre bundles (Fig. 10c) which in turn promoting fibre fracture.

The fibre damage together with the shear strain at the interface between fibres and the matrix promotes the propagation of matrix cracks and leads to further damage at the fibre-matrix interface. At the highest impact energy level considered in this work (30J), an extended damage at the back-side is observed (Fig. 10d). Fibre fracture within several layers from the bottom face together with matrix damage has been observed.

The change in slope is observed in the force-displacement curves for the carbon fibre and it is not observed for the glass fibre composite. The analysis of the damage mechanisms observed at different energy levels provides a potential justification for the above observation. The damage causing the change in stiffness in the carbon fibre composite is fibre fracture at the bottom face and is observed at high impact energy. In the glass fibre composite, fibre fracture appears at lower impact energy (<7.5J) compared to the carbon composite. The change in the stiffness affects the glass fibre composite plates and it is promoted by the stretching of the fibres due to the deflection of the plate. The deflection of the plates is responsible for the failure of the crossing fibre bundles at the contact areas (Fig. 11).

#### 5. Conclusions

This study has investigated the damage mechanisms in woven composite laminate in a matrix of fire-retardant resin and compared the behaviour of carbon and glass fibre composites. Based on the observed results, the following conclusions were drawn:

- The 4.6 mm average thickness woven carbon fibre laminate plates exhibit overall a 40% shorter impact duration, 47% greater peak force value and 27% lower deflection compared with the 3.4 mm average thickness woven glass fibre laminate plates under similar impact energy levels.
- The damage area observed with the C-Scan in the carbon fibre composite plates is smaller than that observed in the glass fibre composite plates under the same impact energy level.
- At the lower impact energy levels, the damage in the tested woven composite laminates is localised at the interface between the fibre

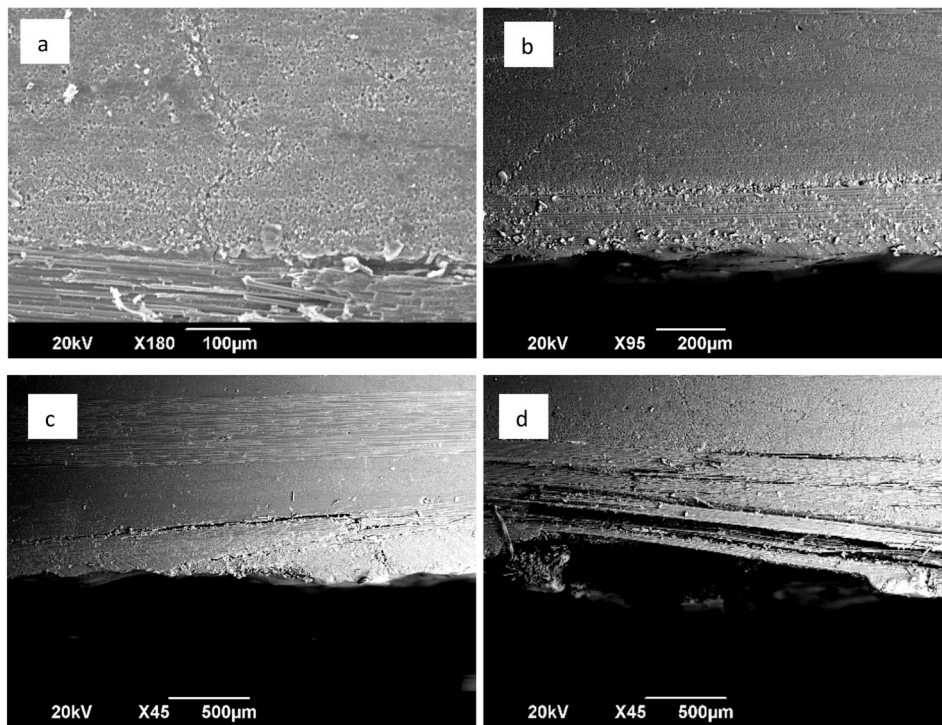


Fig. 9. SEM of the cross section of carbon composite plate tested at a) 15J, b) - c) 20J and d) 30J.

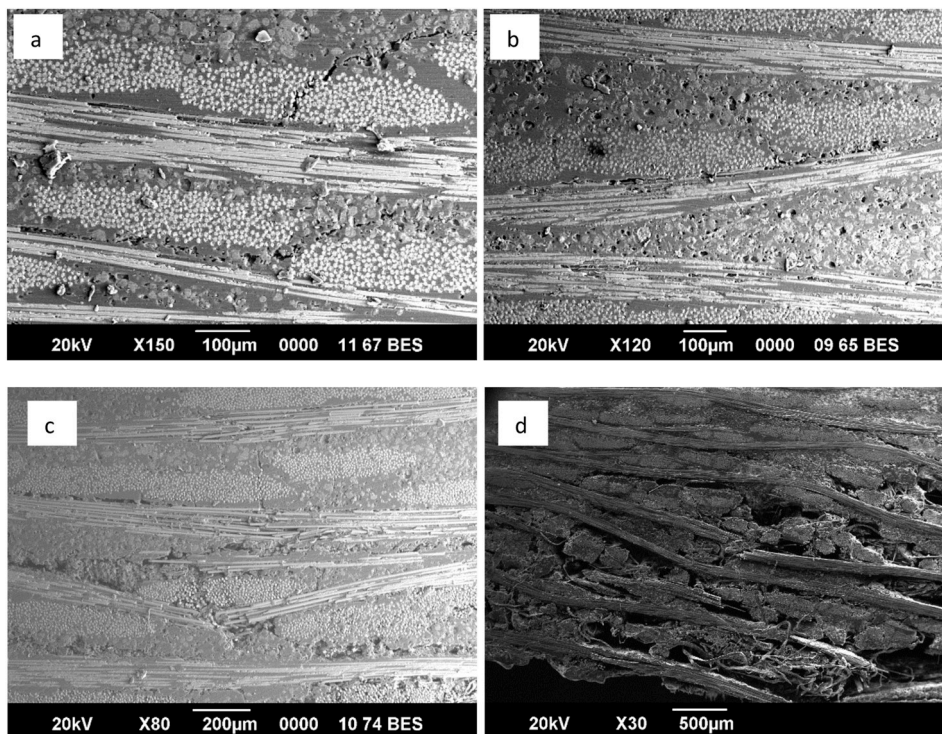


Fig. 10. SEM of the cross section of glass composite plate tested at a) 7J, b) 10J c) 15J and d) 30J.

bundles and the matrix but as the impact energy increases more fibre fracture and matrix cracking are observed.

- The low-velocity impact damage grows progressively without causing any sudden change in the force and in the shape of the force-time history curves, due to the architecture of the woven composites.

- The fibre architecture of the woven material together with the toughened resin allow the woven laminates investigated in this study to exhibit good damage tolerant capacity.

#### Appendix A. Supplementary data

Supplementary data to this article can be found online at <https://doi.org/10.1016/j.compositesb.2019.106888>.

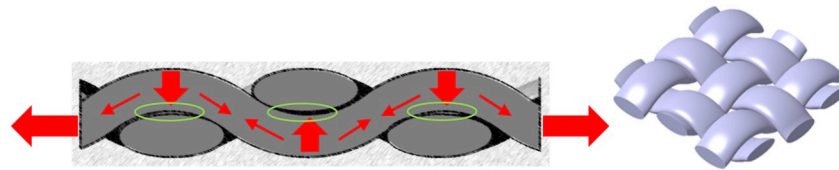


Fig. 11. Schematic representation of the forces in the bundles due to the bending.

org/10.1016/j.compositesb.2019.04.023.

## References

- [1] Xu Y, Shen Z, Tiu W, Xu Y, Chen YK, Haritos G. Delamination threshold load of composite laminates under low-velocity impact. In: *Key engineering materials*; 2013. p. 521–4.
- [2] Grasso M, Penta F, Pucillo GP, Ricci F, Rosiello V. Low velocity impact response of composite panels for aeronautical applications. In: *Proceedings of the world congress on engineering*; 2015.
- [3] Cantwell W, Morton J. The impact resistance of composite materials—a review. *Composites* 1991;22:347–62.
- [4] Schoepfner G, Abrate S. Delamination threshold loads for low velocity impact on composite laminates. *Compos Appl Sci Manuf* 2000;31:903–15.
- [5] Delfosse D, Poursartip A. Energy-based approach to impact damage in CFRP laminates. *Compos Appl Sci Manuf* 1997;28:647–55.
- [6] Zhao GP, Cho CD, Kwon OY. Simulation and experimental investigation of impact damage in composite shell. In: *Key engineering materials*; 2005. p. 1339–43.
- [7] Yang F, Cantwell W. Impact damage initiation in composite materials. *Compos Sci Technol* 2010;70:336–42.
- [8] Hirai Y, Hamada H, Kim J-K. Impact response of woven glass-fabric composites—I: effect of fibre surface treatment. *Compos Sci Technol* 1998;58:91–104.
- [9] Kim J-K, Sham M-L. Impact and delamination failure of woven-fabric composites. *Compos Sci Technol* 2000;60:745–61.
- [10] Evcı C. Thickness-dependent energy dissipation characteristics of laminated composites subjected to low velocity impact. *Compos Struct* 2015;133:508–21.
- [11] Belingardi G, Vadori R. Influence of the laminate thickness in low velocity impact behavior of composite material plate. *Compos Struct* 2003;61:27–38.
- [12] Baucom J, Zikry M. Low-velocity impact damage progression in woven E-glass composite systems. *Compos Appl Sci Manuf* 2005;36:658–64.
- [13] Kang TJ, Kim C. Energy-absorption mechanisms in Kevlar multiaxial warp-knit fabric composites under impact loading. *Compos Sci Technol* 2000;60:773–84.
- [14] Evcı C, Gülgeç M. An experimental investigation on the impact response of composite materials. *Int J Impact Eng* 2012;43:40–51.
- [15] Abrate S. *Impact on composite structures*. Cambridge university press; 2005.
- [16] Lopes C, Seresta O, Coquet Y, Gürdal Z, Camanho P, Thuis B. Low-velocity impact damage on dispersed stacking sequence laminates. Part I: Experiments. *Compos Sci Technol* 2009;69:926–36.
- [17] Aktaş M, Atas C, İçten BM, Karakuzu R. An experimental investigation of the impact response of composite laminates. *Compos Struct* 2009;87:307–13.
- [18] Cavatorta MP, Paolino DS. Damage variables in impact testing of composite laminates. *Compos Mater Res Prog* 2008:237.
- [19] Naik NK, Sekher YC, Meduri S. Damage in woven-fabric composites subjected to low-velocity impact. *Compos Sci Technol* 2000;60:731–44.
- [20] Ferdous W, Ngo TD, Nguyen KTQ, Ghazlan A, Mendis P, Manalo A. Effect of fire-retardant ceram powder on the properties of phenolic-based GFRP composites. *Compos B Eng* 2018;155:414–24. 2018 15 December.
- [21] Liang JZ, Feng JQ, Tsui CP, Tang CY, Liu DF, Zhang SD, et al. Mechanical properties and flame-retardant of PP/MRP/Mg(OH)<sub>2</sub>/Al(OH)<sub>3</sub> composites. *Compos B Eng* 2015;71:74–81. 2015 15 March.
- [22] Chen X, Yuan L, Zhang Z, Wang H, Liang G, Gu A. New glass fiber/bismaleimide composites with significantly improved flame retardancy, higher mechanical strength and lower dielectric loss. *Compos B Eng* 2015;71:96–102. 2015 15 March.
- [23] Standard A. D7136: standard test method for measuring the damage resistance of a fiber-reinforced polymer matrix composite to a drop-weight impact event. West Conshohocken: ASTM International; 2005.
- [24] Sutherland L, Soares CG. Impact on low fibre-volume, glass/polyester rectangular plates. *Compos Struct* 2005;68:13–22.
- [25] Timoshenko Stephen P, Woinowsky-Krieger Sergius. *Theory of plates and shells*. McGraw-hill; 1959.
- [26] Giannopoulos IK, Theotokoglou EE, Zhang X. Impact damage and CAI strength of a woven CFRP material with fire retardant properties. *Compos B Eng* 2016;91:8–17.
- [27] Caprino G, Lopresto V, Durante M, Iaccarino P. On the first failure energy of glass-fiber-reinforced plastic panels impacted at low velocity. *Mech Adv Mater Struct* 2011;18:396–402.
- [28] Boumbimba RM, Froustey C, Viot P, Gerard P. Low velocity impact response and damage of laminate composite glass fibre/epoxy based tri-block copolymer. *Compos B Eng* 2015;76:332–42.